

ARCHITECTURE
HISTORIC PRESERVATION
HISTORICAL INTERIORS

1105 West 42nd Street
Austin, Texas 78756
(T) 512.476.0433
(F) 512.476.2198

BRAZORIA COUNTY HISTORICAL MUSEUM
EXTERIOR RESTORATION AND REPAIR
ANGLETON, TEXAS

PROJECT NO: 010-10


DATE: 06/15/11

REV:


SHEET NAME:
DETAILS

SHEET NO:


A-400

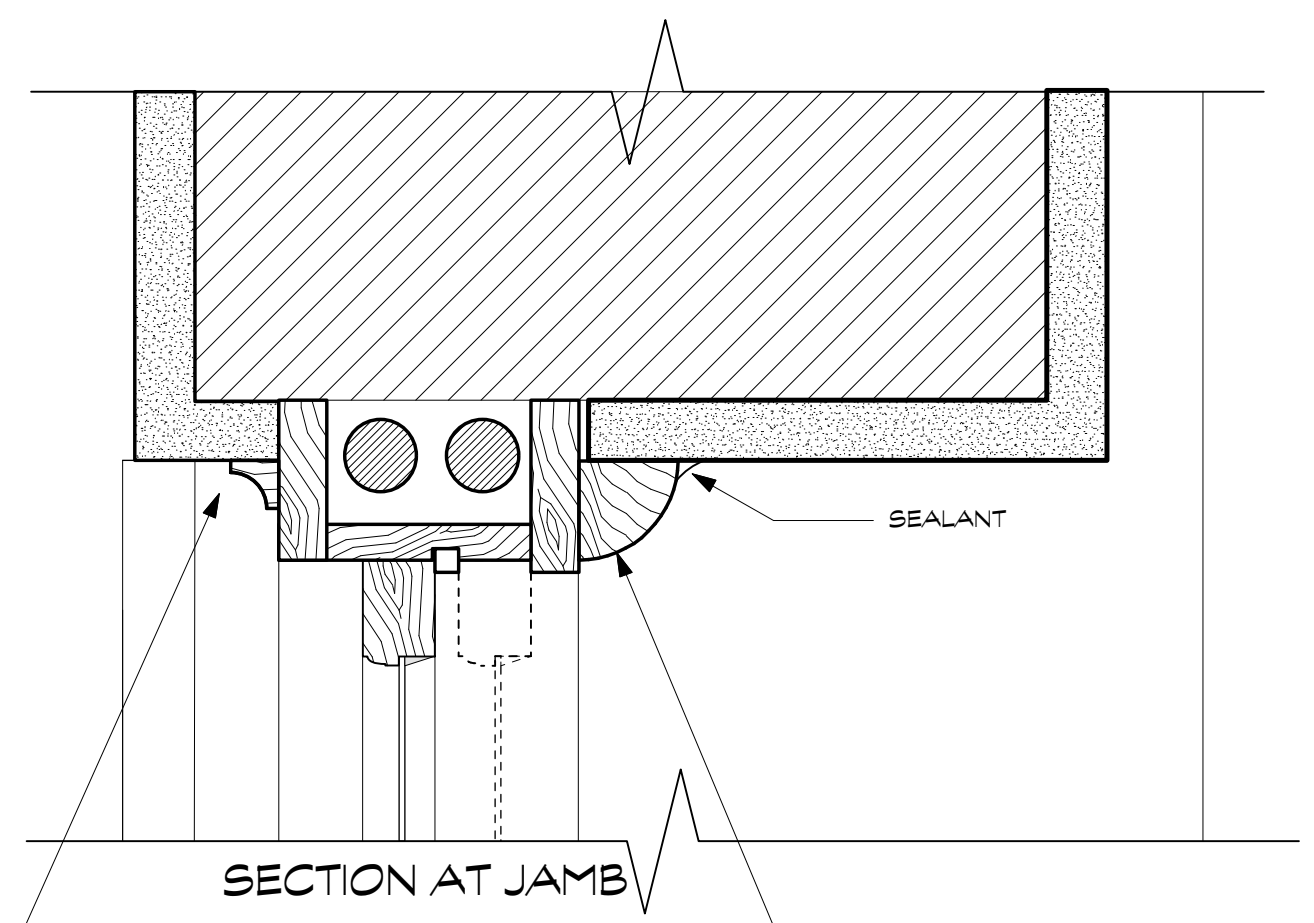


INSPECT JAMB, TRIM AND BRICK MOLD AFTER SASH REMOVAL AND EPOXY REPAIR AS NEEDED - REPLACE SEVERELY DAMAGED PIECES WITH NEW TRTD WOOD - RE-SECURE LOOSE TRIM - SAND PRIME AND RE-PAINT ALL EXT. WOOD - REMOVE ALL EXISTING SEALANT RESIDUE AND RE-SEAL PERIMETER

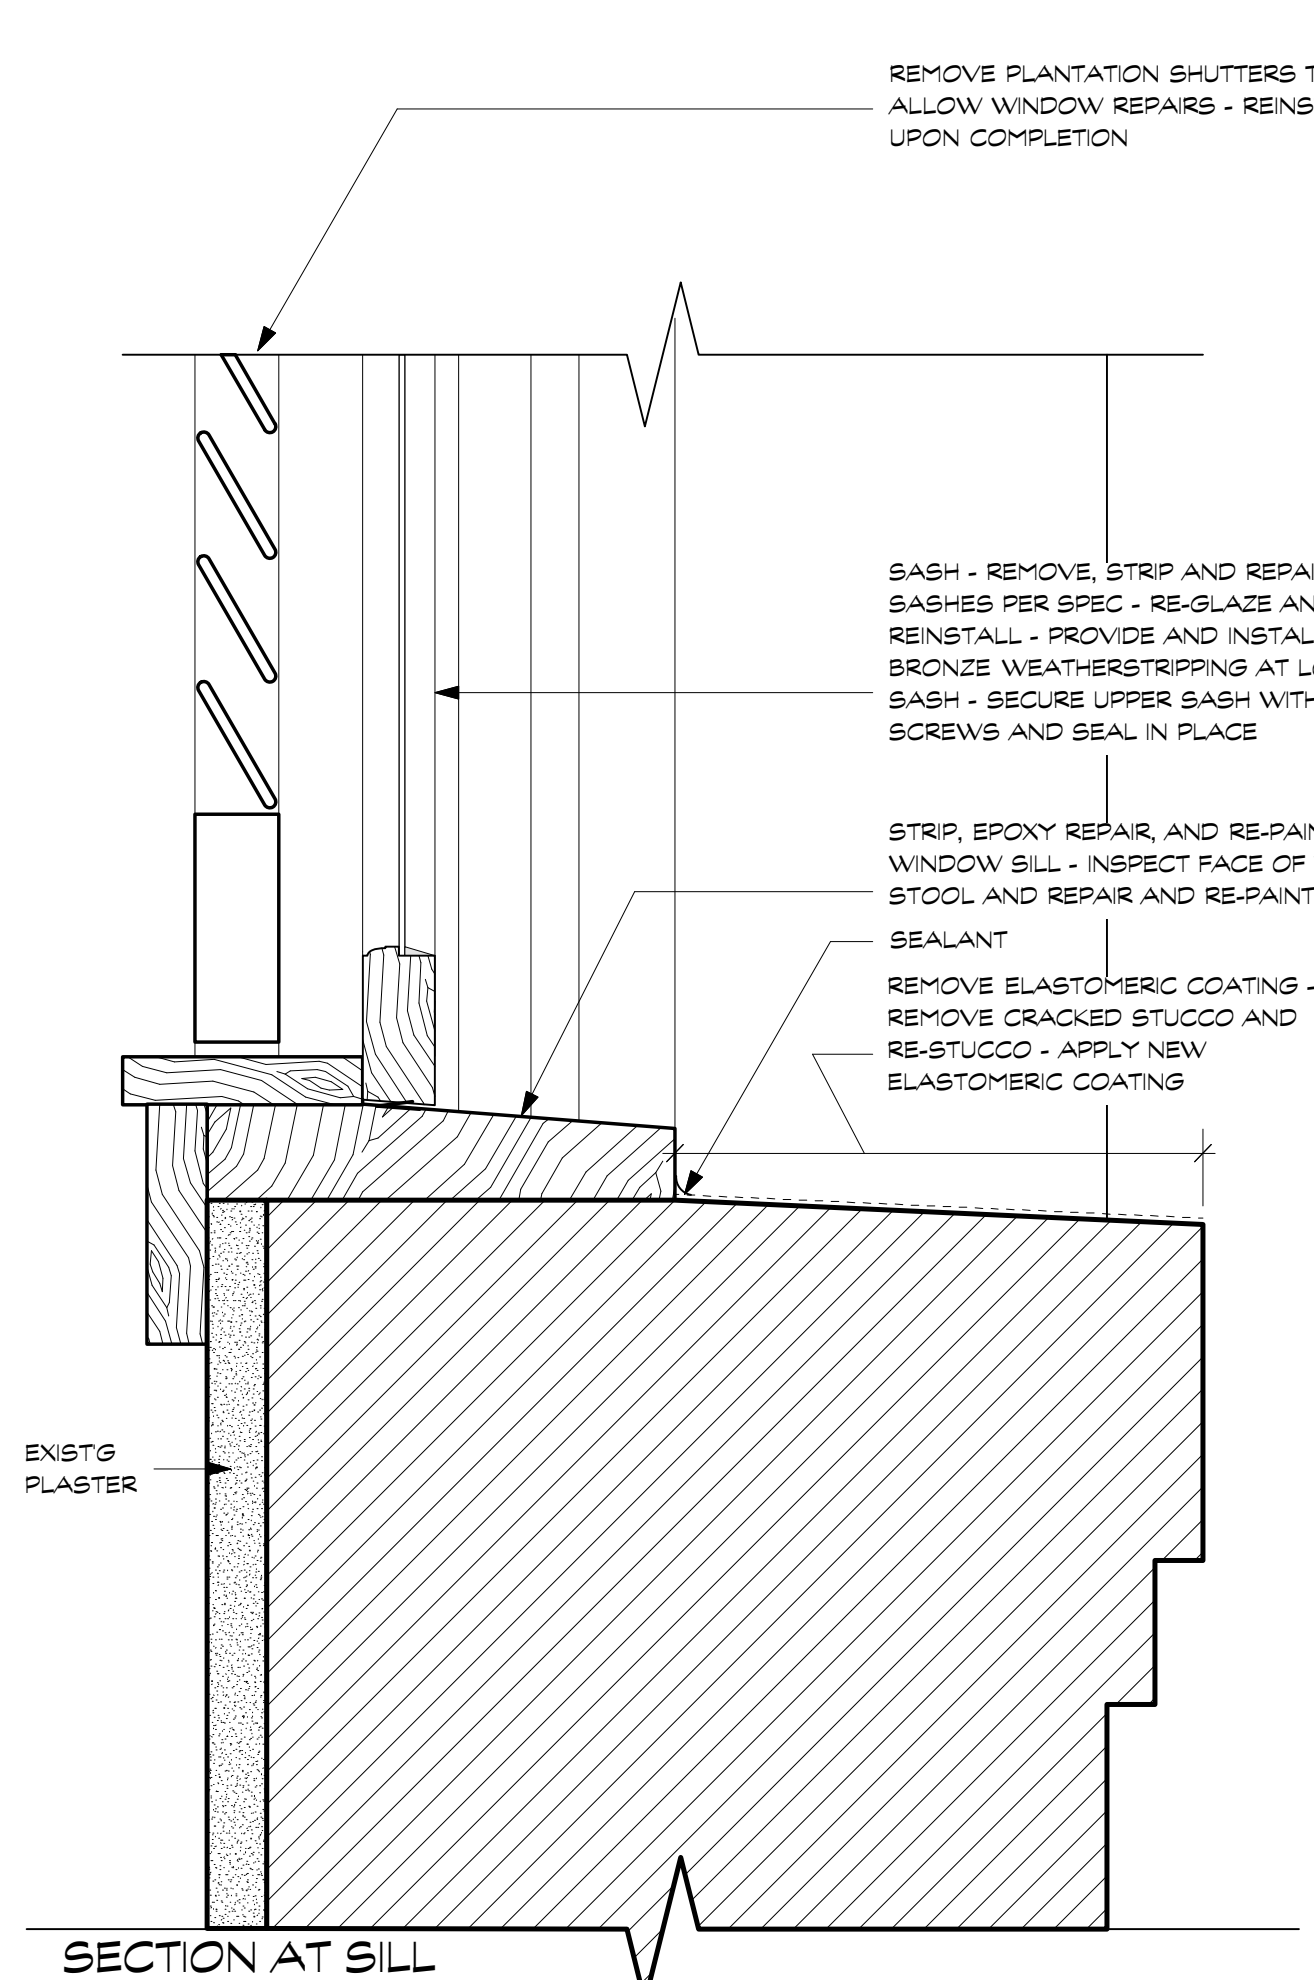


A1 WINDOW DETAIL
SCALE: 3" = 1'-0"

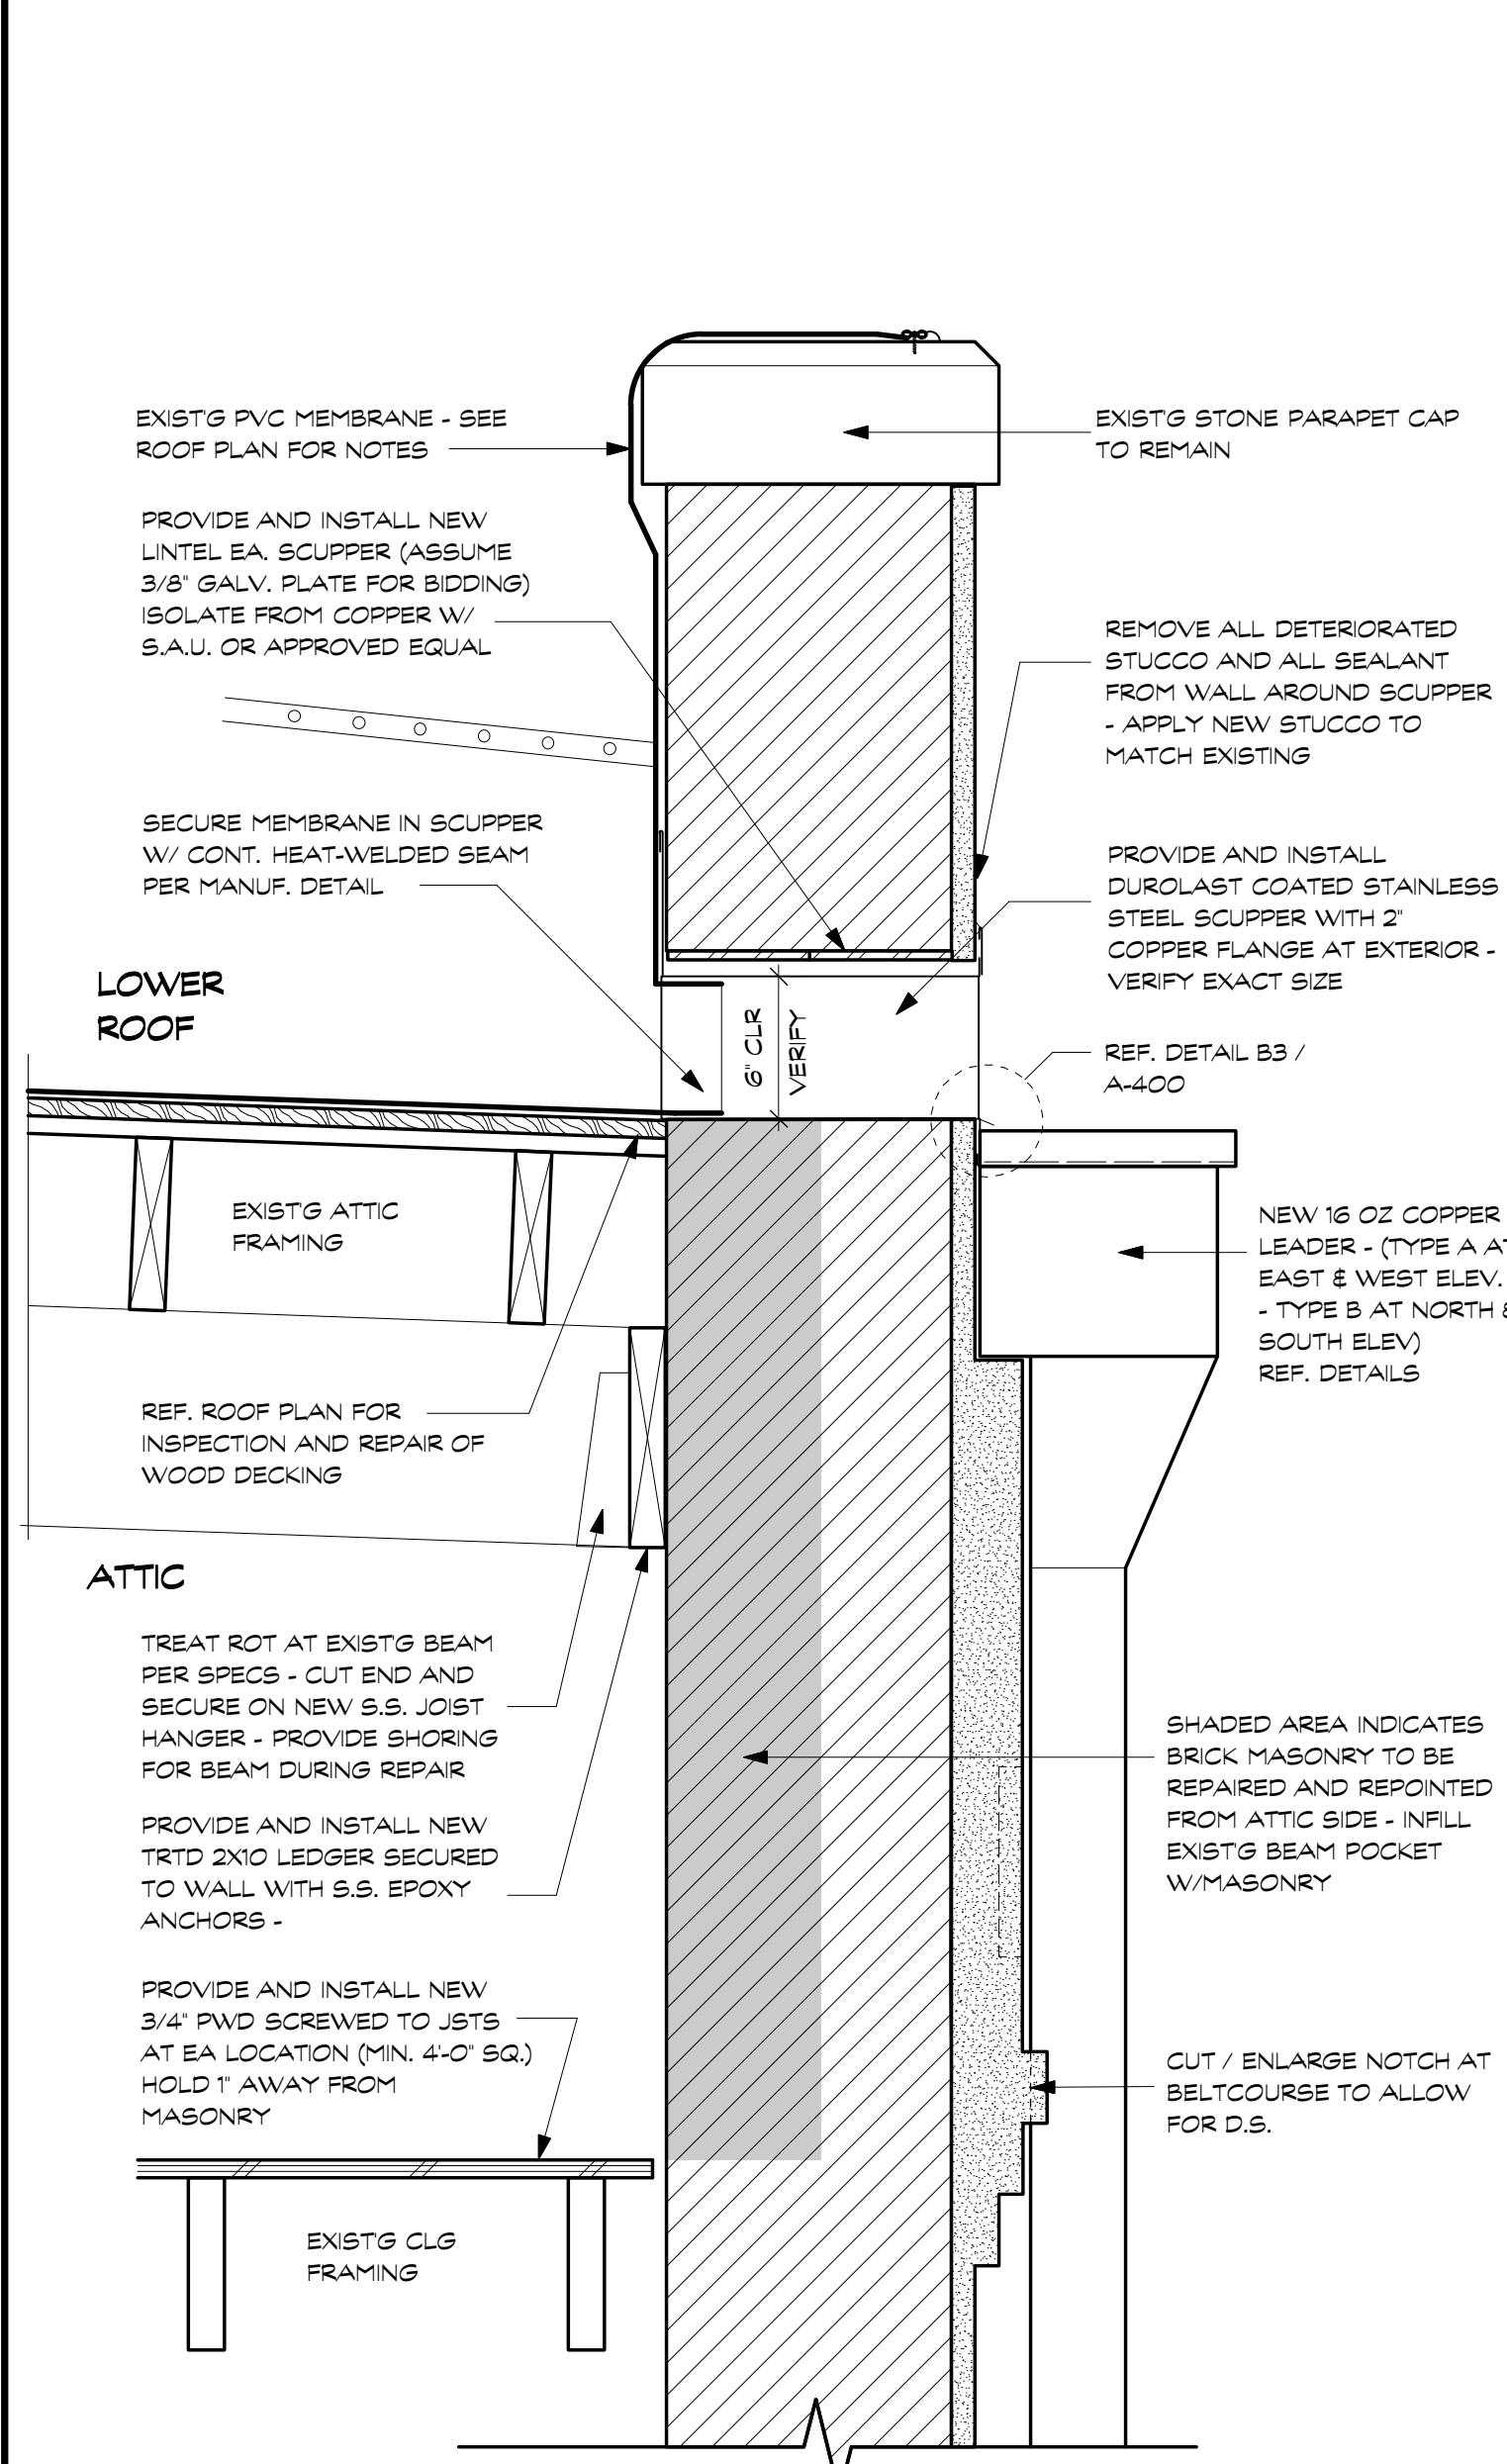


B2 SCUPPER AT LOWER ROOF
SCALE: 1-1/2" = 1'-0"

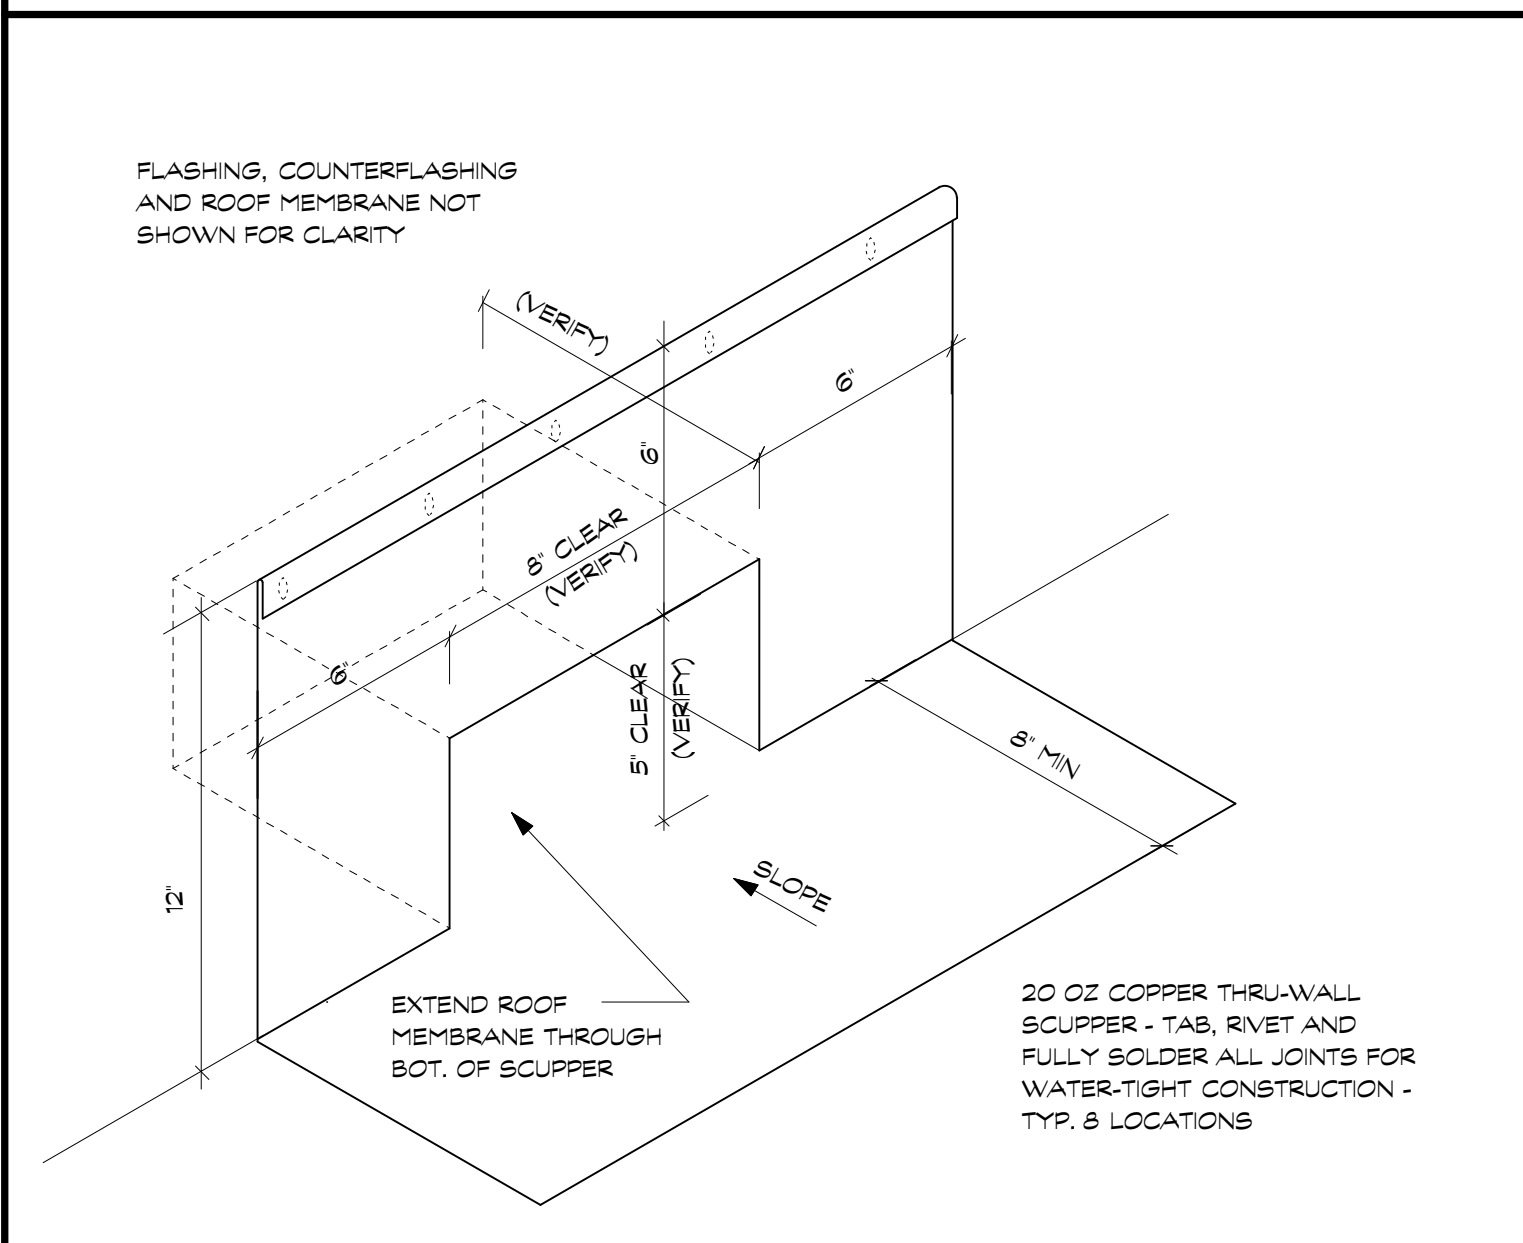


A2 SCUPPER AT UPPER ROOF (REAR VIEW)
SCALE: N.T.S.

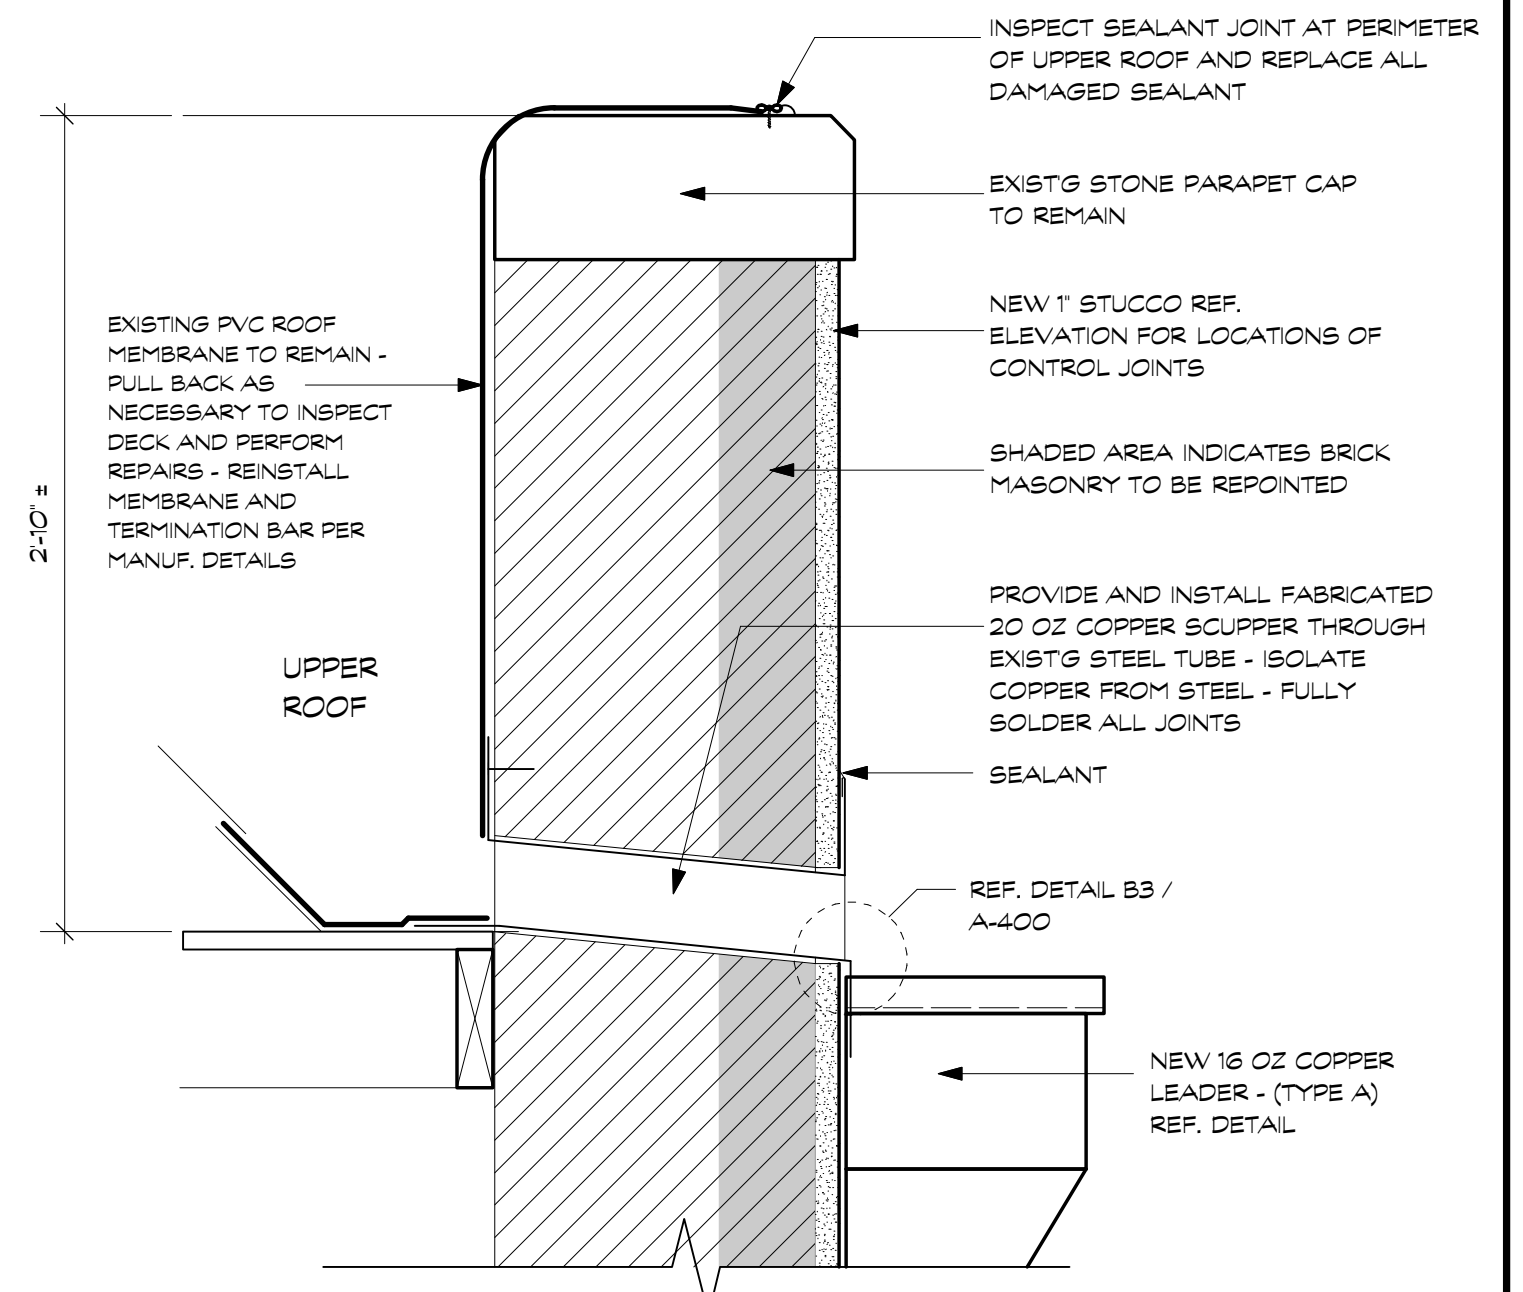


C3 SCUPPER AT UPPER ROOF
SCALE: 1-1/2" = 1'-0"

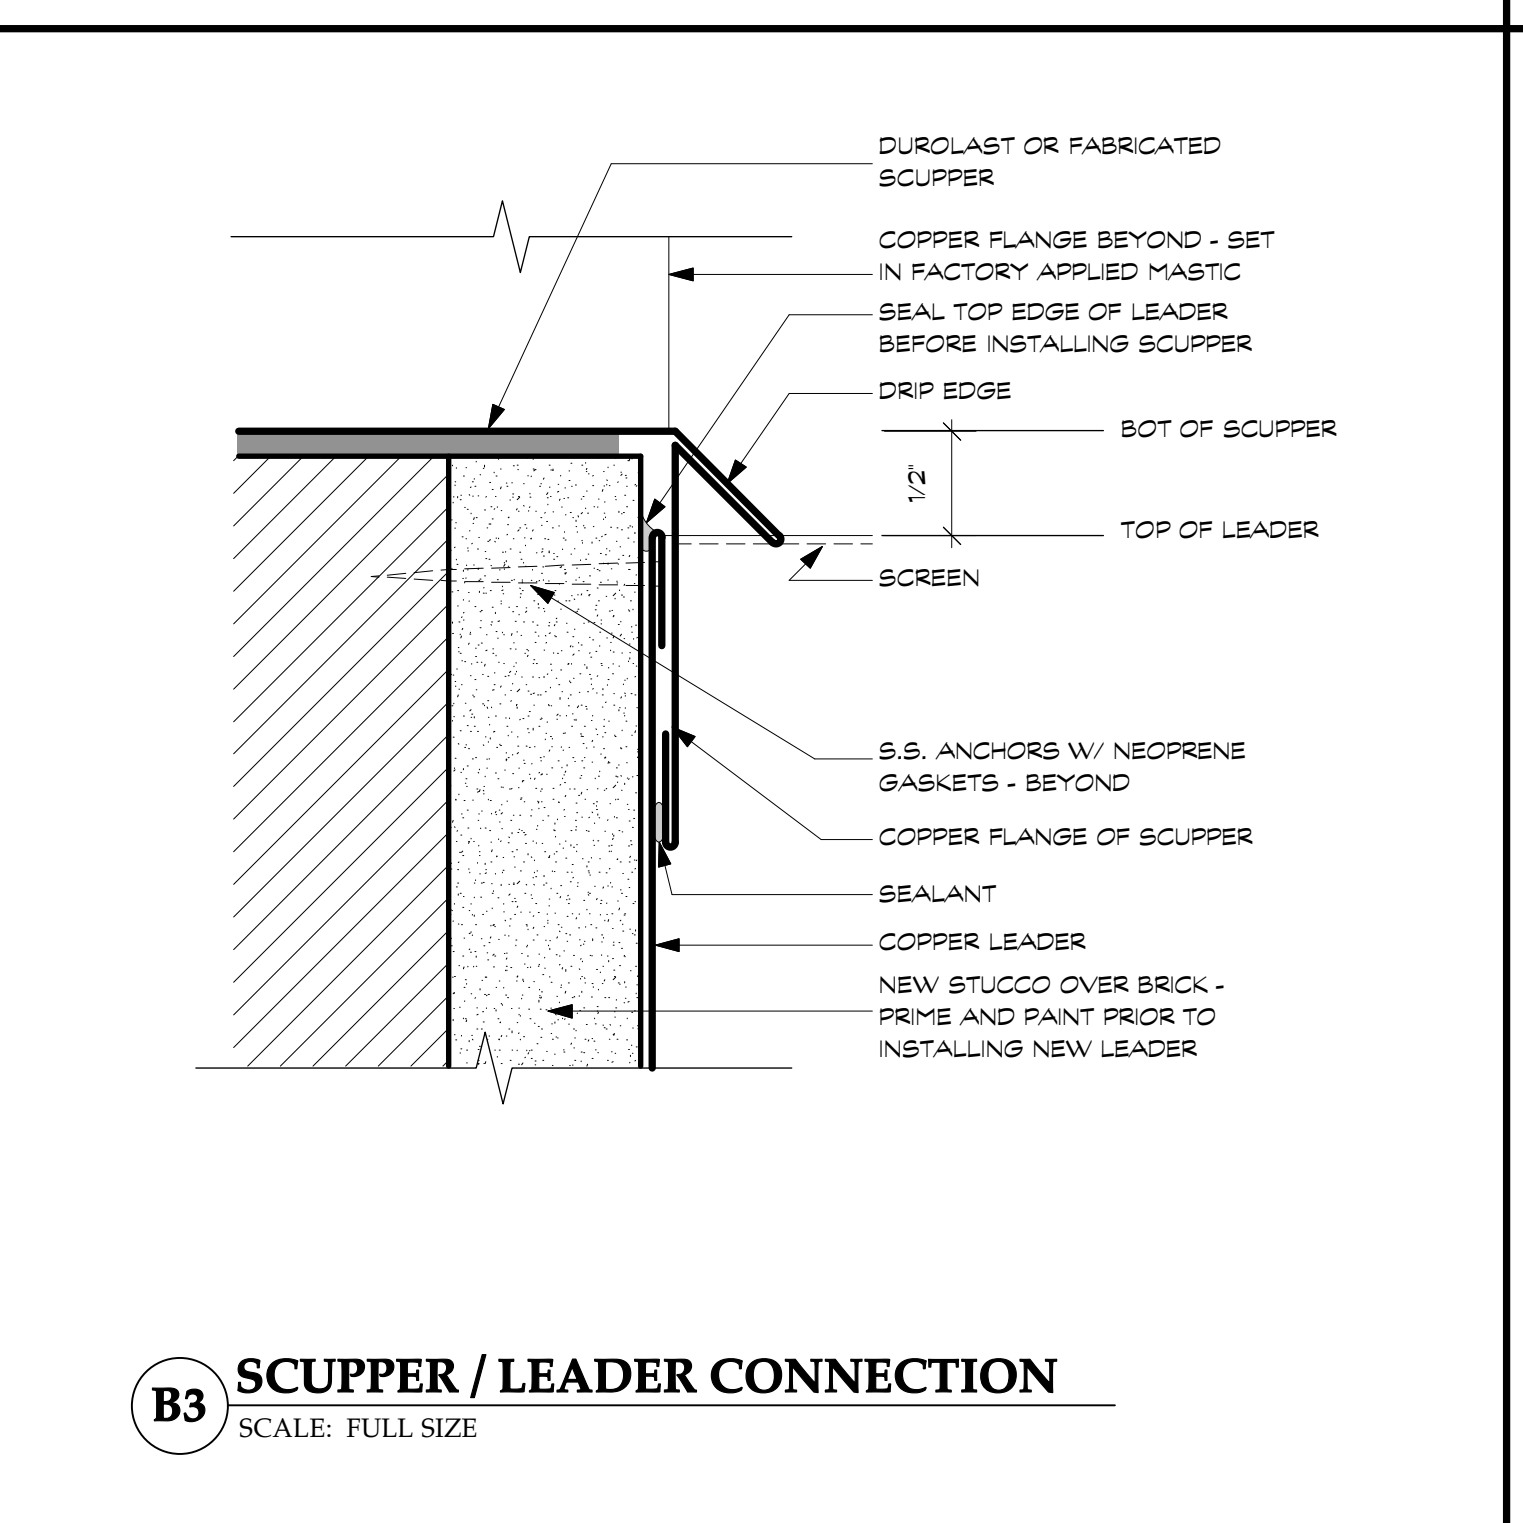


B3 SCUPPER / LEADER CONNECTION
SCALE: FULL SIZE

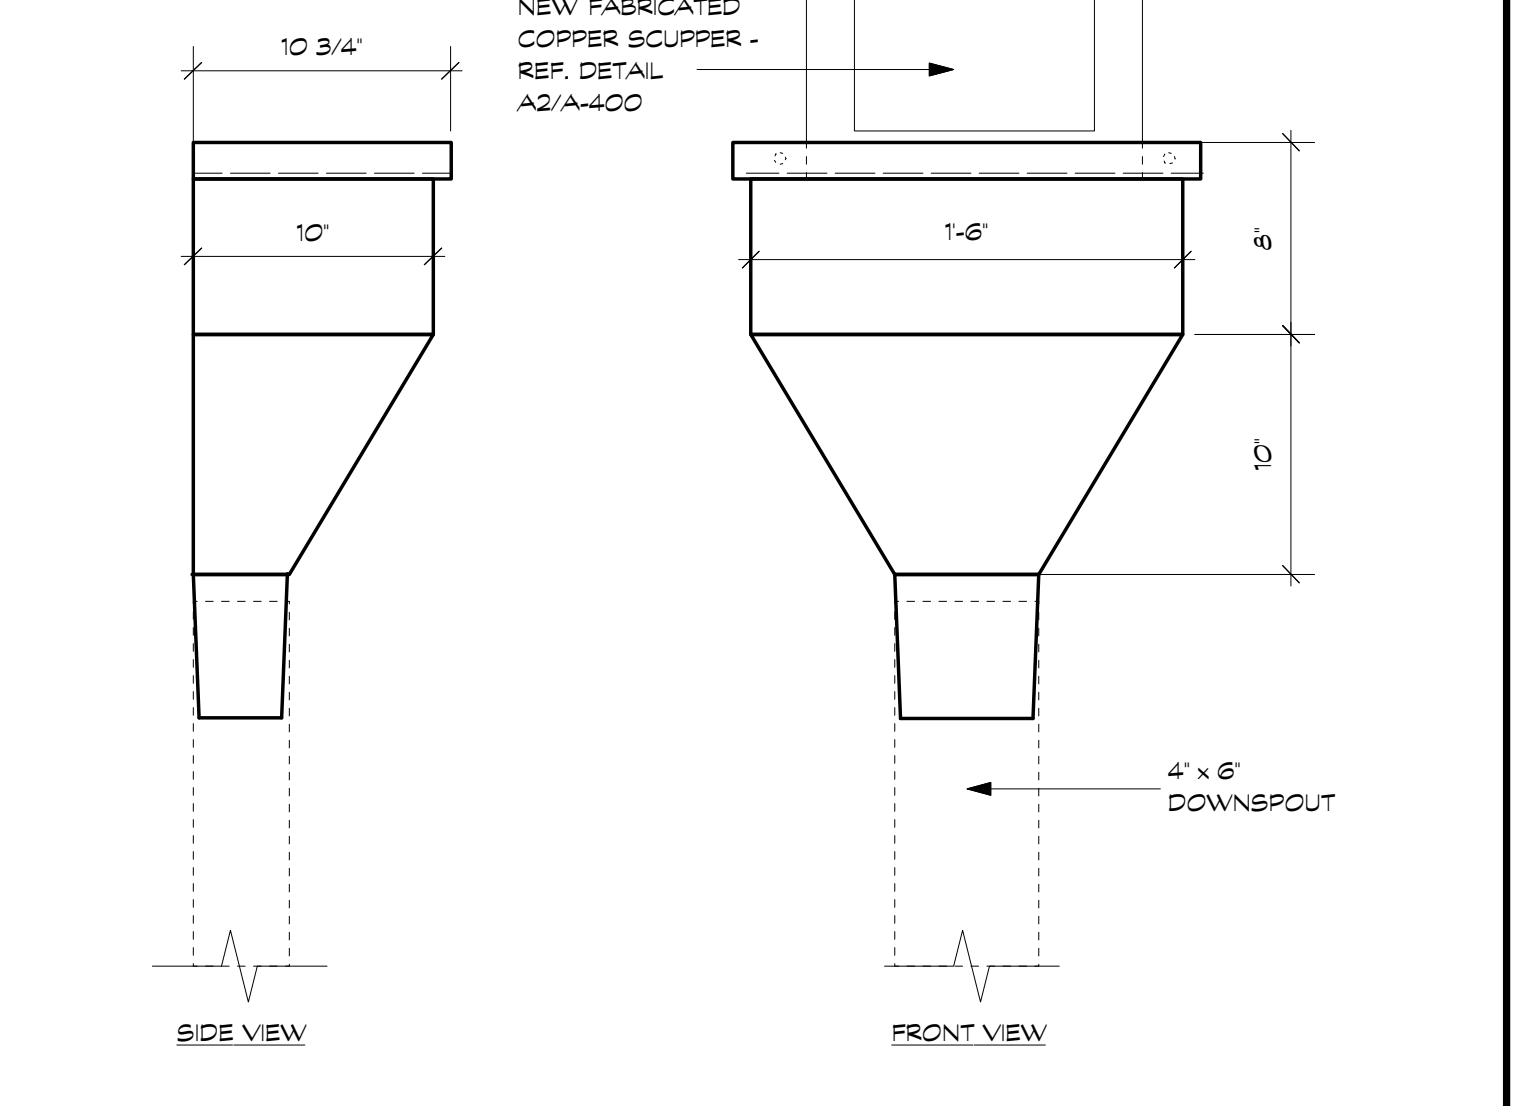


A3 LEADER DETAIL - TYPE A
SCALE: 1-1/2" = 1'-0"

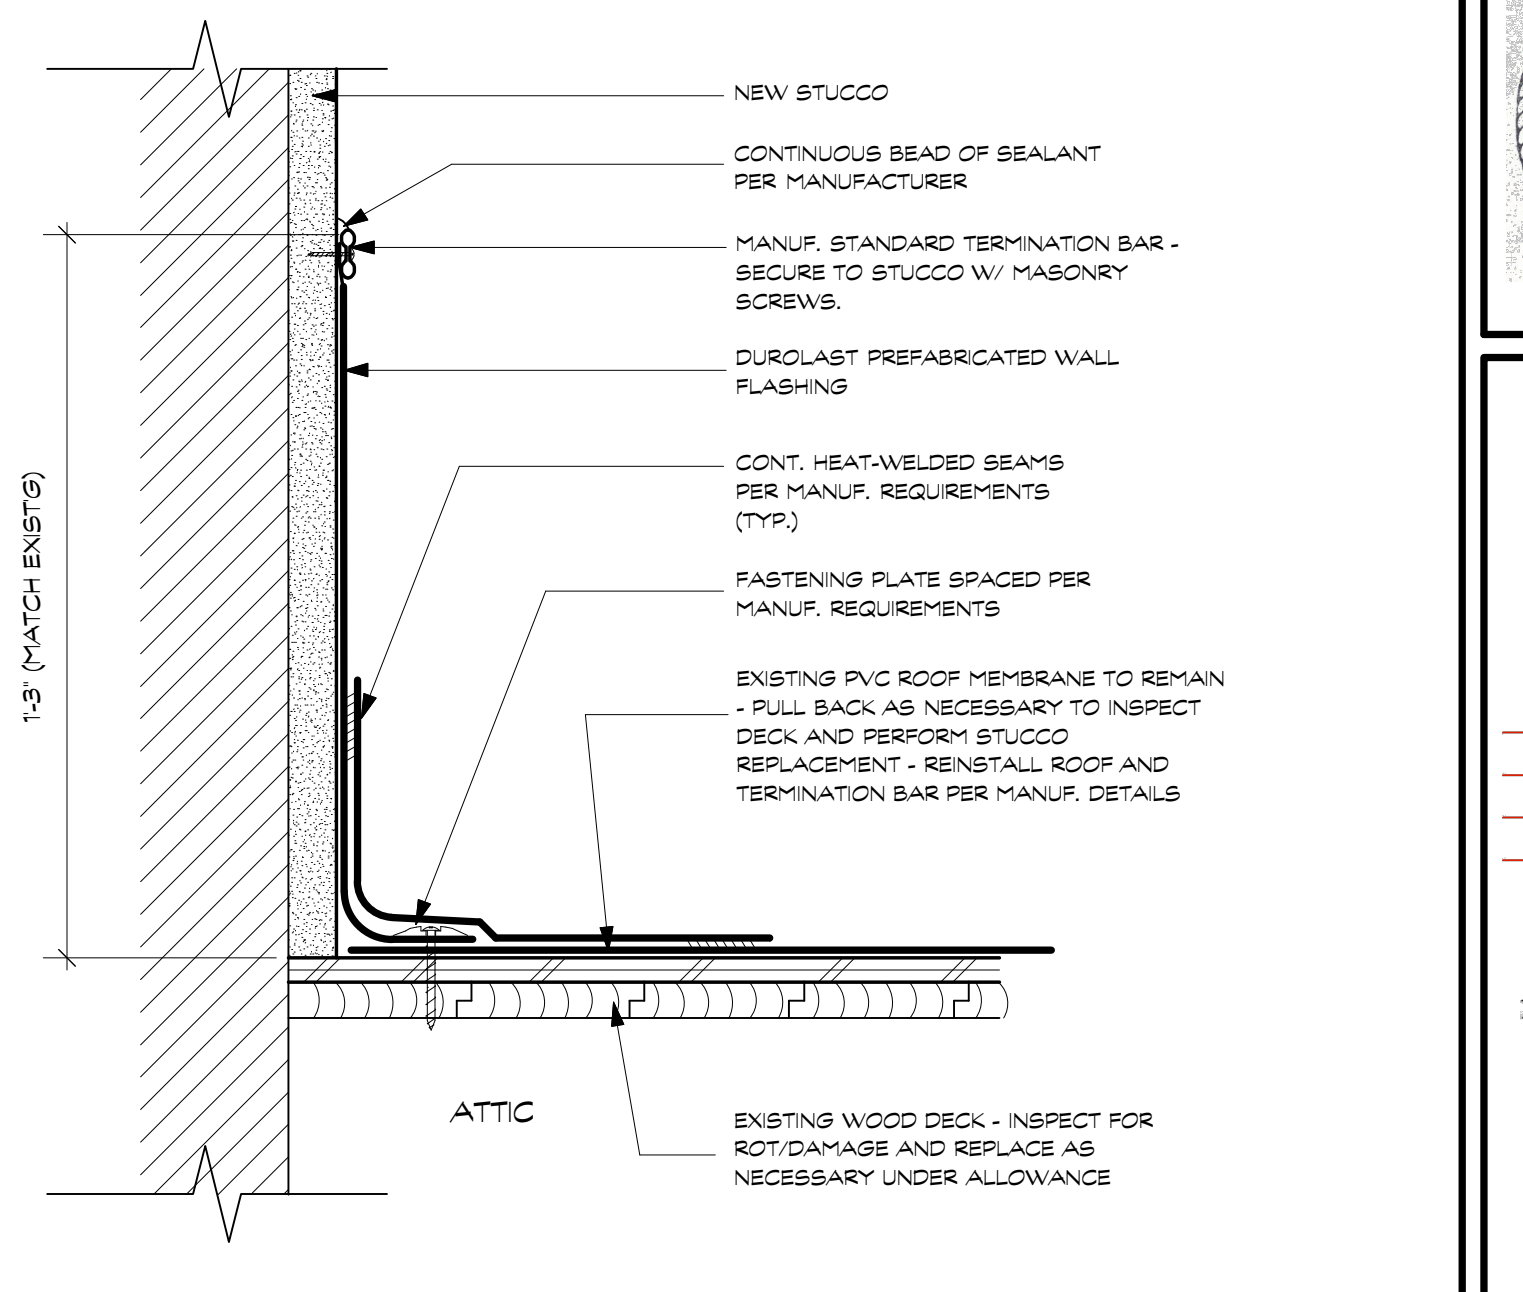

C4 ROOF FLASHING AT PARAPET WALL
SCALE: 3" = 1'-0"

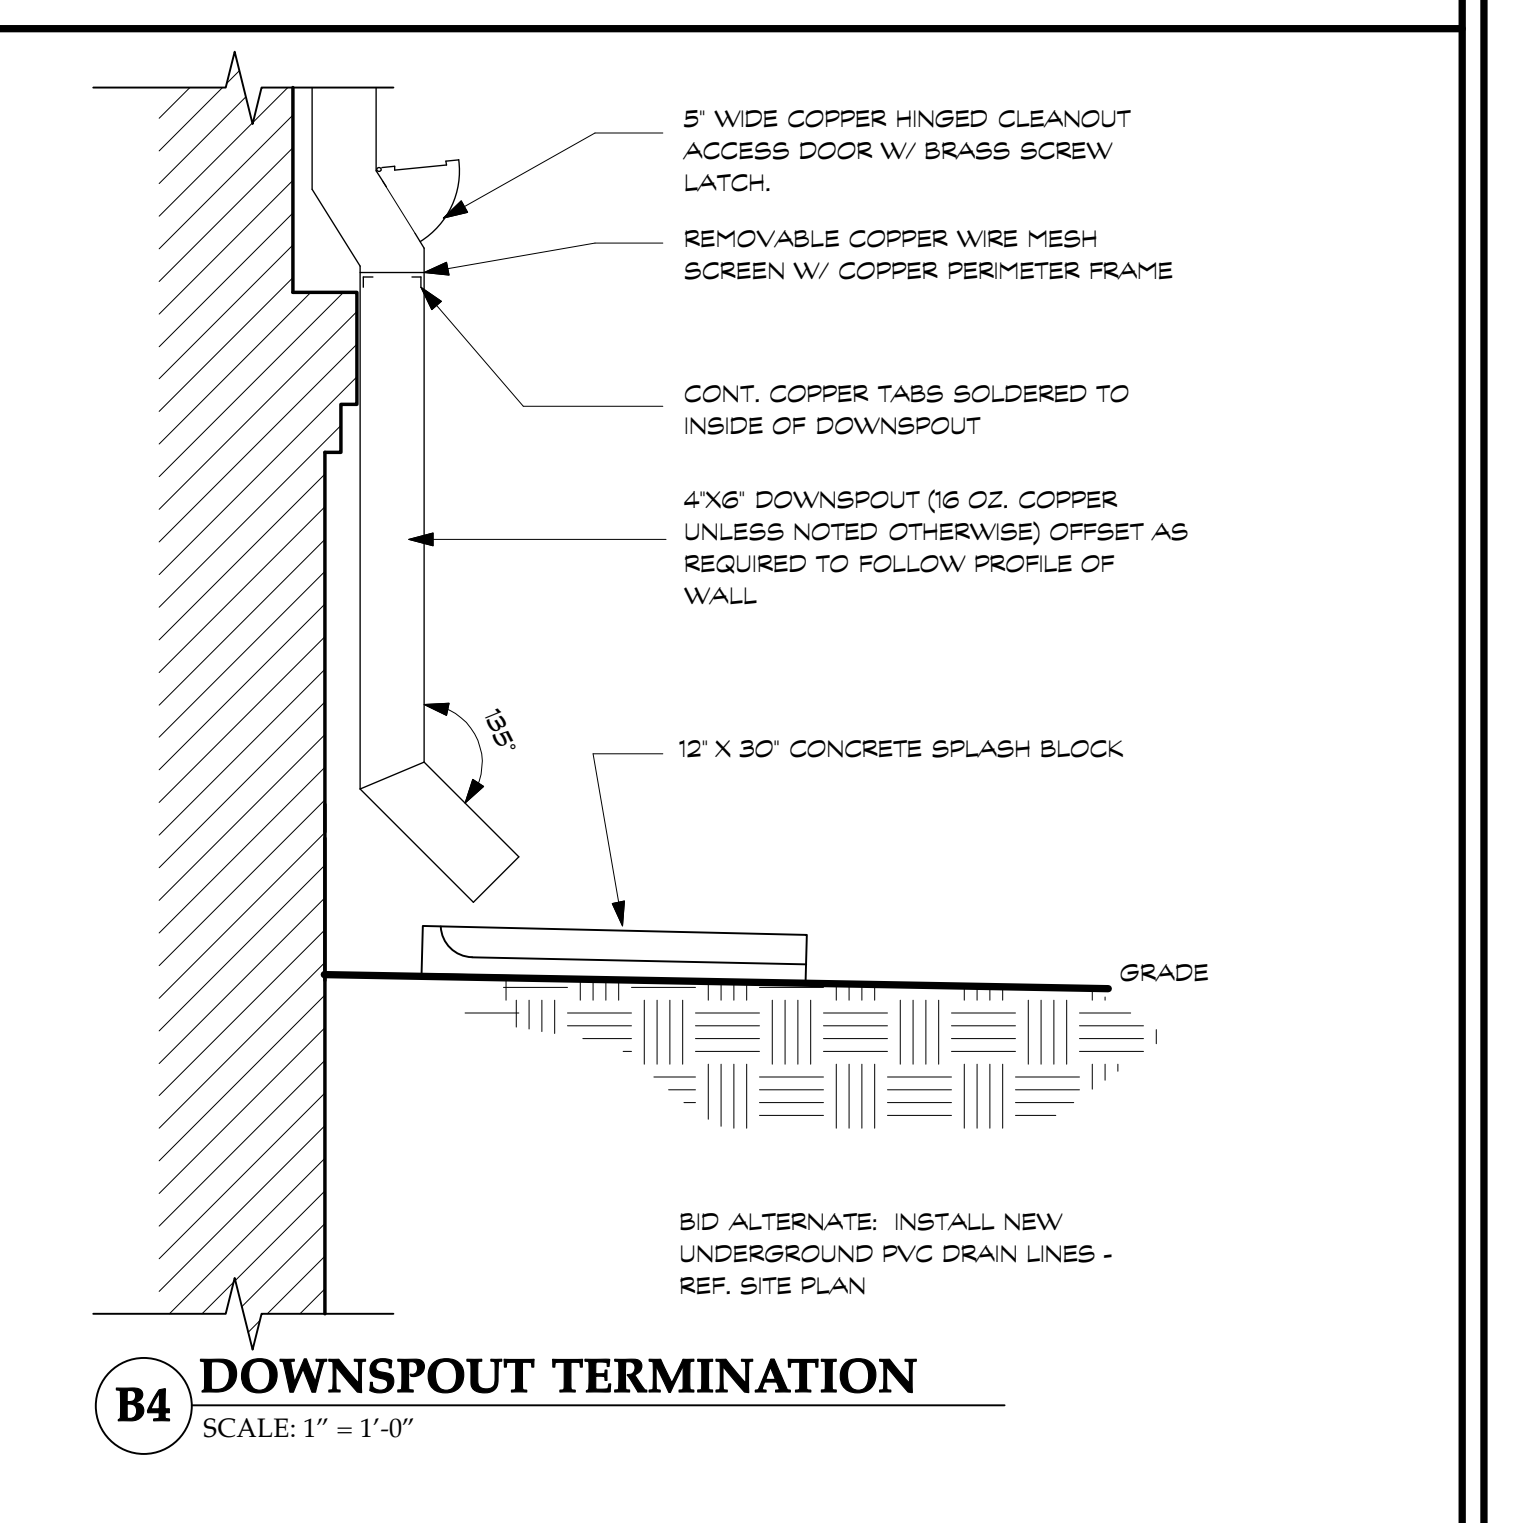

B4 DOWNSPOUT TERMINATION
SCALE: 1" = 1'-0"

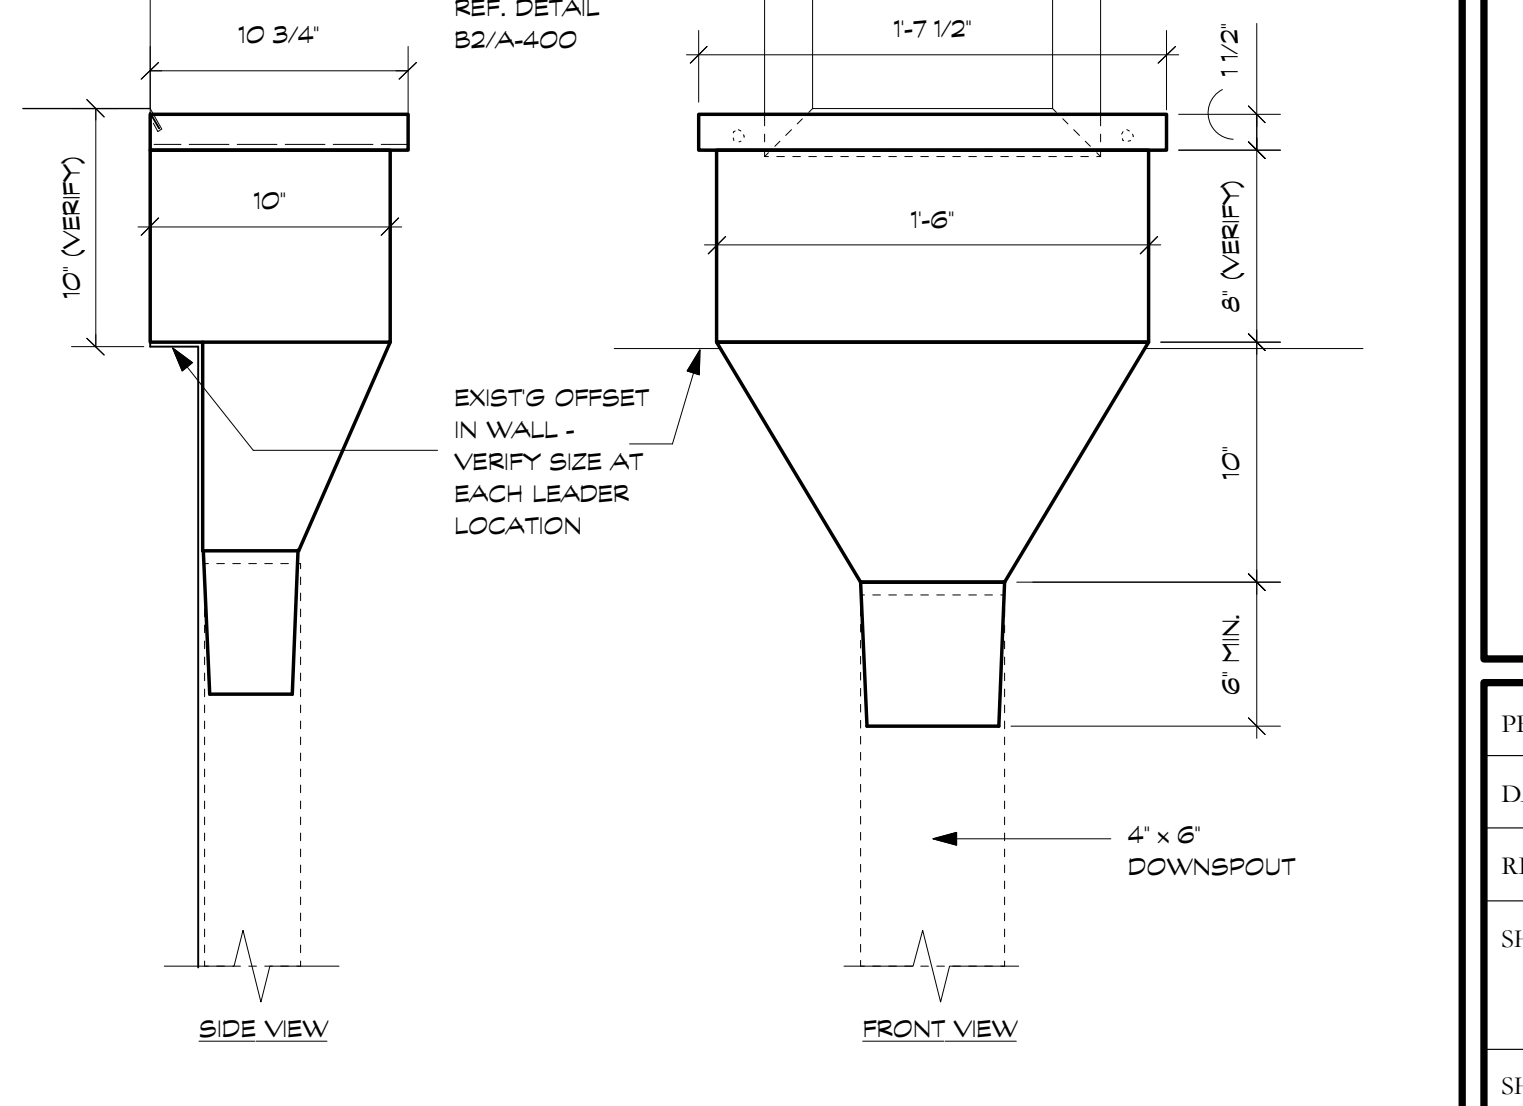

A4 LEADER DETAIL - TYPE B
SCALE: 1-1/2" = 1'-0"